



STEP NO. 1: IDENTIFY EXISTING CAP SHEET
MEMBRANE FLASHING PLY W/ UN-ADHERED AREA

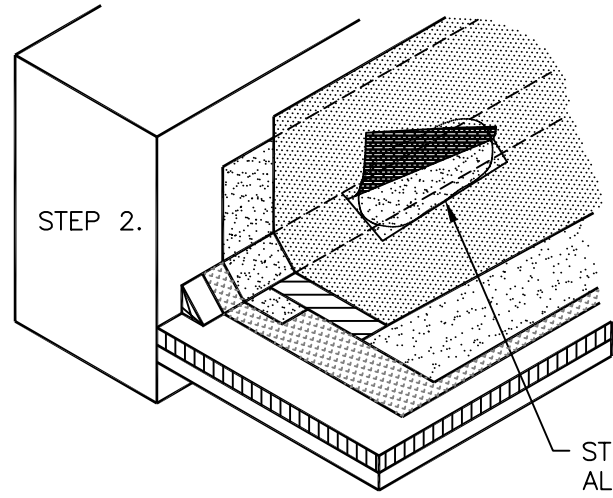


STEP NO. 2: CUT ALONG THE DOWN SLOPE SIDES OF UN-ADHERED CAP AREA AND PEEL UPWARD

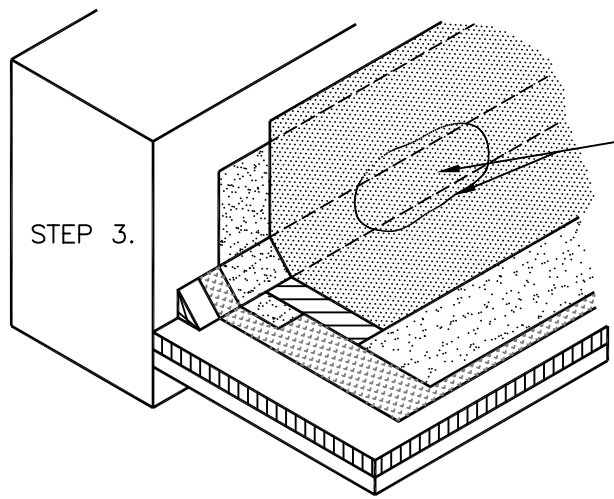

STEP NO. 3: HOT AIR WELD UN-ADHERED CAP FLASHING ONTO BASE PLY. MOLECULARLY FUSE THE CUT EDGES TO THE ADHERED CAP FLASHING EDGES.

NOTES:
1. DETAIL TO BE USE IN CONJUNCTION WITH SOPREMA GENERAL REQUIREMENTS, APPLICATION METHODS AND APPROVED DETAILS.

		310 QUADRAL DRIVE	
		WADSWORTH, OHIO 44281	
		(330) 334-0066	
TITLE			
CAP FLASHING MEMBRANE REPAIR			
SCALE	DWN	CHK	APPROVAL DATE
NONE	DMT	BS	12/1/06
DRAWING NUMBER			REV
MISC-014			0

** USAGE OF THIS DRAWING IS GOVERNED BY THE TERMS OF SERVICE FOR SOPREMA DETAIL. PLEASE CONSULT THESE TERMS OF SERVICE PRIOR TO UTILIZING THIS DRAWING.